Knick >

indicators are uni-versally applicable. The range (either 0 to 20 mA or 4 to 20 mA) is simply selected via terminals. Display starts working at an operating current of only 0.3 mA. The low voltage drop of 0.5 V allows application in current loops with low load voltage.

The 830 X loop-powered digital

830 X Loop-Powered **Process Indicator**







Bargraph for quick range overview

The digital indicators provide a bargraph in addition to the digital display. This gives you all information on your process variable at a single glance.

Versatile setting capabilities

Zero, span, and min/max outputs can be adjusted as desired, enabling direct readout of measured values such as temperature, power, displacement, pH value etc. The indicator comes with a symbol set for standard engineering units. The symbols can easily be replaced. Thanks to microprocessor technology, you do not require a high-precision external reference current for parameter setting. Even during operation, the settings can be changed without problems.

Loop-powered. Your advantage.

The digital indicators are simply inserted into the current loop like passive analog indicators. Since power supplies and their wiring are not required, costs could decisively be reduced, allowing for displays which have been too expensive before. Applications in hazardous locations become easier and less expensive since the costs for intrinsically safe power supplies and wirings can be saved.








830 X Process Indicator







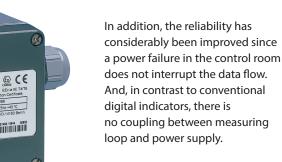

Construction

The product line includes indicators in modular cases as well as large and small cases for installation in equipment and control panels. The cases are sealed to IP 65.

Floating min/max outputs on request

The two optionally available min/ max outputs with IS/IS separation can be set as normally closed or normally open contacts. Limit values, hysteresis and switch-on delay can be set as desired.

EMV to NAMUR*

EMC design ensures reliable measurements even under unfavorable ambient conditions.

HART communication

The indicators transmit HART signals disturbance-free. Measured value display is not affected.

* German committee for measurement and control standards in the chemical industry

The facts

Digital indication without power supplies and supply leads

No signal interference due to power supply coupling

Power failure without effect on indication

No parasitic voltages

Unproblematic, extremely lowcost application in hazardous area

Universal range selection

Exchangeable unit symbols

Adjustable, floating min/max outputs, optional

Signal isolation between IS circuits

IP 65

Large 23 mm characters,

- 4-digit display
- Span up to 10,000 counts
- Display range -9999 to +9999

Range overview by integrated bargraph

Voltage drop 0.5 V

Settings user defined without external reference current

Change of settings also during operation

Settings protected by passcode

For hazardous-area applications

For use in HART circuits

Warranty vears!

Warranty

Defects occurring within 3 years from delivery date shall be remedied free of charge at our works (carriage and insurance paid by sender).



830 X Process Indicator

■ Product Line

Instrument		Ref. No.	
830 X R Process Indicator	Loop-powered & indicator in modular case with standard symbol set	830 X R	
830 X S1 Process Indicator	Loop-powered & indicator in panel-mount case (96 x 48 mm) with standard symbol set	830 X S1	
830 X S2 Process Indicator	Loop-powered & indicator in panel-mount case (144 x 72 mm) with standard symbol set	830 X S2	
Options			
Additional Pg cable gland	For version R as branching box	119	
Outputs	Versions S1 and S2 with two min/max outputs (60 V DC, 150 mA, 0.7 / 0.35 V)	291	
Range selection	Range fixed according to customer requirements	365	
Accessories			
Symbol	Other unit symbol (not standard symbol set)	ZU 0129	
Pipe mount kit	Pipe-mount kit (only version R)	ZU 0154	

■ Standard symbol set





Specifications

4 to 20 mA, voltage drop approx. 0.5 V 0.3 to 20 mA, voltage drop approx. 3.2 V		
LCD: character height 23 mm (R, S2), 16 mm (S1). 4-digit measured value display, sign, 3 decimal points Function indicators: par, 0 mA, 4 mA, 20 mA, min, max, hyst, s, n/c, n/o, adj, bargraph limits Bargraph with 2 % resolution, height approx. 3.5 mm (R, S2), approx. 2.5 mm (S1)		
-9,999 to +9,999		
Span up to 10,000 counts, displacement up to ±9,999 counts Bargraph user defined within span Rising / falling characteristic		
4 buttons [TAB]par, [▲] span, [▶] mA, ent par: [TAB]Activate parameter mode [▲] span: [TAB]In parameter mode: select submenu, count up selected digit, In measuring mode: alternately display start/end of scale [▶] mA: [TAB]In parameter mode: select digit, In measuring mode: display loop current ent: [TAB]Confirm entered value		
User defined, without, P1, P2, P3		
1/s		
<0.1 % of measured value ±2 counts		
<0.01 % of span / K ±0.1 count / K (average over permissible temperature range)		
±150 mA		
Floating solid-state switches (min and max), 60 V DC, 350 mA Voltage drop when switched approx. 0.5 V, With input currents <0.3 mA (<3.8 mA) or >approx. 24 mA the solid-state switches block Hysteresis: [TAB]0 to 9,999 counts, user defined Switch-on delay: [TAB]0 to 9,999 s, user defined Contact type: [TAB]normally closed (n/c) or normally open (n/o), user definable Separate indication of switching state on display Display flashing can be turned off		
Set of 20 symbols and five blank labels included		
II 2(I)G EEx ia IIC T4/T6		
Stranded wire: [TAB]up to 1.5 mm ² Single wire: [TAB]up to 2.5 mm ² (S1, S2), up to 1.5 mm ² (R)		
Parameters and calibration data >10 years (EEPROM)		
EN 61326		
Accuracy during disturbance <1 % span		

830 X Process Indicator

continued – **Specifications** 830 X Process Indicator


	830 X R	830 X S1	830 X S2
Ambient temperature Operation:	-25 to +40 °C (T6) -25 to +55 °C (T5) -25 to +65 °C (T4)	-10 to +40 °C (T6) -20 to +55 °C (T4, T5)	
Storage:	-30 to +70 °C	−20 to +70 °C	
Adjustments	Internal	Front panel	
Min/max outputs	No .	Yes (Option 291)	
Enclosure	Version R: modular	Version S1: panel	Version S2: panel
Material	Al Si 12, DIN 1725, with glass pane, Insert made of Byblend, Rating plate: polyester	Front panel overlay: polyester, with window, Front: PA + GF, sides: Al, Rear: PA + GF	Front panel overlay: polyester, with glass pane, Front and sides: PA + GF, Rear: PA + GF
Color	Lid: iron gray RAL 7011, Bottom: gray RAL 7001, Insert: black	Front: iron gray RAL 7011, Sides: Al, Rear: black, Buttons: black	Front: iron gray RAL 7011, Sides and rear: black, Buttons: black
Dimensions in mm (incl. terminals and cable glands)	W 200 x H 80 x D 57	W 96 x H 48 x D 118	W 144 x H 72 x D 57
Protection (EN 60529) Front to control panel: Rear:	IP 65	IP 65 IP 20	
Weight	Approx. 750 g	Approx. 300 g	Approx. 300 g



■ Typical applications


Application with 2-wire transmitter and repeater power supply (e.g. Knick WG 20 or WG 21)

Indicators can be mounted either in hazardous or safe area and due to different enclosure versions on the site or in the control panel.

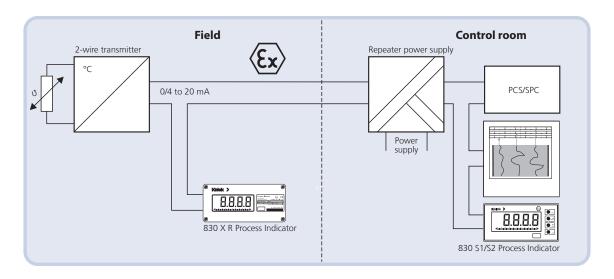

Application with 4-wire transmitter and IS/non-IS isolator (e. g. Knick IsoTrans® 36 A7)


Indicators can be mounted either in hazardous or safe area and due to different enclosure versions on the site or in the control panel.

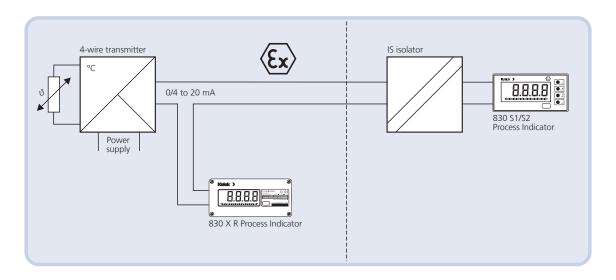


830 X Process Indicator


■ Dimension drawings

830 X R Process Indicator

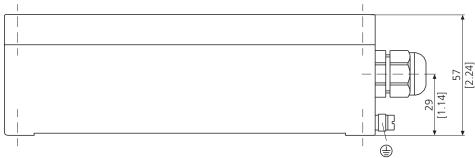

Bottom view

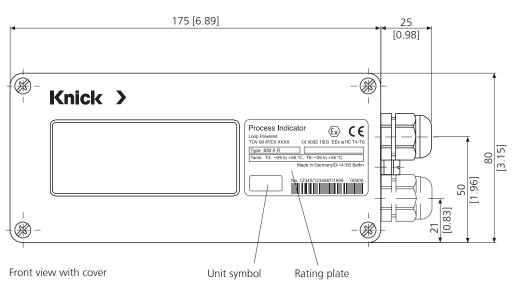

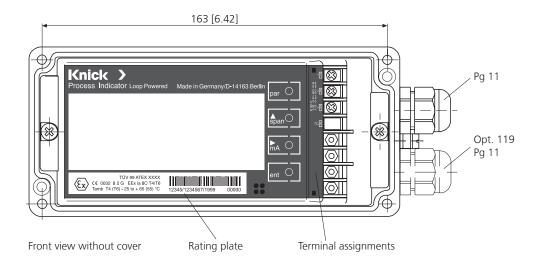


Note: All dimensions in mm [in]




■ Dimension drawings

830 X R Process Indicator

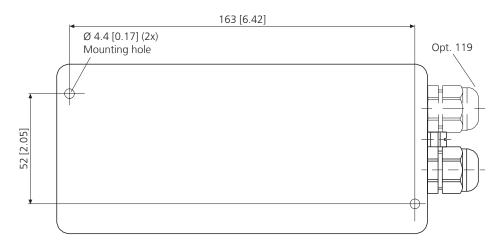

Rear view

Note: All dimensions in mm [in]

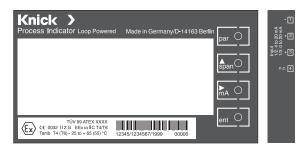



Keypad

Subject to change! 27

830 X Process Indicator

■ Dimension drawings

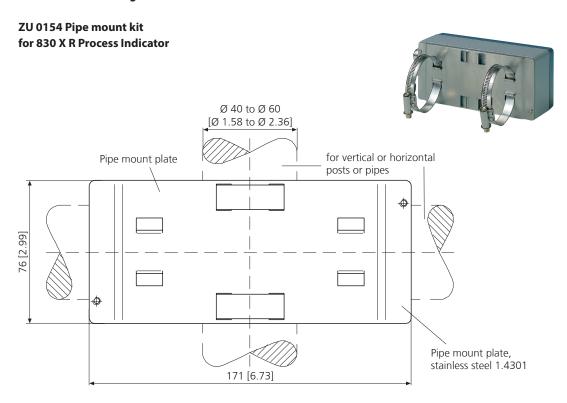

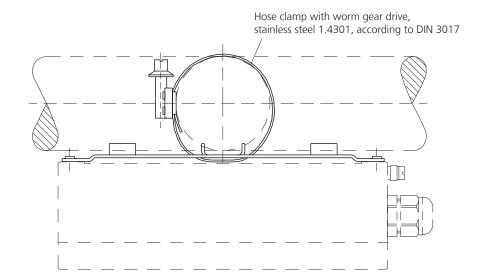

Note: All dimensions in mm [in]


28 | Subject to change!

29





■ Dimension drawings

830 X S1 Process Indicator

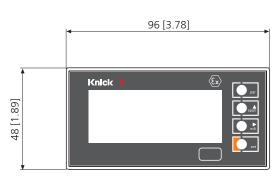




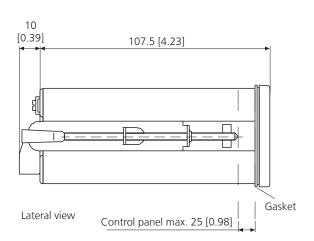

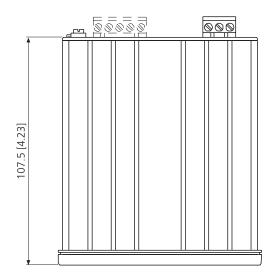

Top view

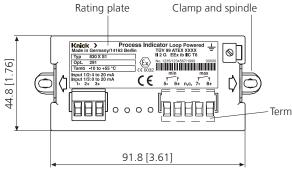


Terminals for switching outputs (Opt. 290)


Rear view Note: All dimensions in mm [in]

830 X Process Indicator


■ Dimension drawings


830 X S2 Process Indicator

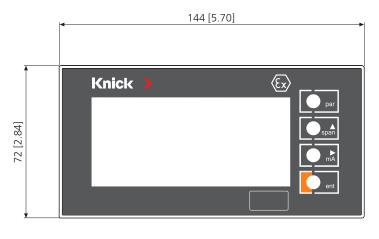

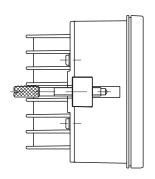

Front view Lateral view

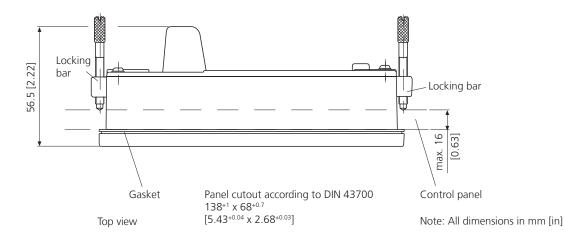

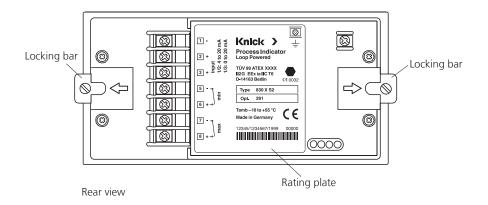

30 | Subject to change!



По вопросам продаж и поддержки обращайтесь:

Архангельск (8182)63-90-72 Астана +7(7172)727-132 Астрахань (8512)99-46-04 Барнаул (3852)73-04-60 Белгород (4722)40-23-64 Брянск (4832)59-03-52 Владивосток (423)249-28-31 Волгоград (844)278-03-48 Волгоград (8172)26-41-59 Воронеж (473)204-51-73 Екатеринбург (343)384-55-89 Иваново (4932)77-34-06 Ижевск (3412)26-03-58 Иркутск (395) 279-98-46 Киргизия (996)312-96-26-47 Казань (843)206-01-48
Калининград (4012)72-03-81
Калуга (4842)92-23-67
Кемерово (3842)65-04-62
Киров (8332)68-02-04
Краснодар (861)203-40-90
Красноярск (391)204-63-61
Курск (4712)77-13-04
Липецк (4742)52-20-81
Магнитогорск (3519)55-03-13
Москва (495)268-04-70
Мурманск (8152)59-64-93
Набережные Челны (8552)20-53-41
Нижний Новгород (831)429-08-12
Казахстан (772)734-952-31

Новокузнецк (3843)20-46-81 Новосибирск (383)227-86-73 Омск (3812)21-46-40 Орел (4862)44-53-42 Оренбург (3532)37-68-04 Пенза (8412)22-31-16 Пермь (342)205-81-47 Ростов-на-Дону (863)308-18-15 Рязань (4912)46-61-64 Самара (846)206-03-16 Санкт-Петербург (812)309-46-40 Саратов (845)249-38-78 Севастополь (8692)22-31-93 Симферополь (3652)67-13-56 Таджикистан (992)427-82-92-69

Сургут (3462)77-98-35 Тверь (4822)63-31-35 Томск (3822)98-41-53 Тула (4872)74-02-29 Тюмень (3452)66-21-18 Ульяновск (8422)24-23-59 Уфа (347)229-48-12 Хабаровск (4212)92-98-04 Челябинск (351)202-03-61 Череповец (8202)49-02-64 Ярославль (4852)69-52-93

Смоленск (4812)29-41-54

Ставрополь (8652)20-65-13

Сочи (862)225-72-31

Эл. почта kci@nt-rt.ru || Сайт: http://knick.nt-rt.ru